



WatchGas MGD

Portable Gas Detector

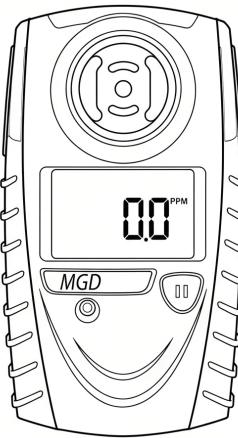

v1.2

1

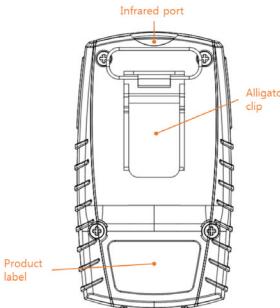

3. LCD Icons Description



Icon	Description
	Low alarm and high alarm. These signs are displayed when gas concentration exceeds alarm setpoints.

WatchGas MGD Instruction Manual

WatchGas MGD is a personal safety device designed for monitoring the atmosphere for potentially hazardous level of a gas enrichment or deficiency in diffusion mode using one electrochemical sensor for one of three gases, Oxygen (O₂), Carbon Monoxide (CO) or Hydrogen Sulfide (H₂S) by selecting at order. Power is provided by one, non-user replaceable, lithium-thionyl chloride primary cell. Readings are displayed on LCD and the device has audible, visual, and vibrating alarms when set, user-configurable conditions are exceeded. It is your responsibility to respond appropriately to the alarms. WatchGas MGD has no facilities for connection of external electrical circuits. WatchGas MGD has IR communications for changing the alarm set point, the calibration range and etc. The IR communications shall only be used in safe area.

WARNING

- 1) WatchGas MGD is designed for use and comes with a non-field replaceable lithium-ion battery, filter and sensor already installed and ready for use.
- 2) Do not attempt replacement or substitution of components. Replacement or Substitution of components may impair Intrinsic Safety and will void the warranty of the product.
- 3) The electrical, electronic and battery elements of this product must not be disposed of via municipal waste streams; they should be disposed of by a qualified recycler or hazardous materials handler. Correct disposal will contribute to recycling of materials and prevent negative consequences for the environment.
- 4) It is recommended performing a bump test prior to WatchGas MGD use every day to confirm sensor response and alarm activation by exposing the detector to a concentration of target gas that exceeds the low alarm set point.
- 5) In case of WatchGas MGD O₂, for optimal performance, periodically calibrate zero for the sensor.
- 6) For all gas type of WatchGas MGD, always proceed bump test and calibration at room temperature and in a fresh air environment (20.9% v/v O₂) that is free of hazardous gas.
- 7) The display window may have potential electrostatic charging hazard.

Therefore, do not rub or wipe the display window to avoid the build up of electrostatic charge on the surface. Additionally, the display window shall only be cleaned with a damp cloth.

CAUTION!


- 1) Activate WatchGas MGD before the activation date on the package.
- 2) In order to maintain normal operation of WatchGas MGD, keep the gas sensor grill from clogging and keep the gas sensor, LED and buzzer hole surfaces free from dust and dirt. Clean the exterior with a soft and damp cloth.
- 3) When using WatchGas MGD, sudden change in the temperature may cause change in the detected gas concentration value suddenly. Using in a stable temperature environment is recommended for more accurate detection.
- 4) WatchGas MGD is a gas detector, not a measurement device.
- 5) Portable safety gas detectors are life safety devices. Accuracy of ambient gas reading is dependent upon factors such as accuracy of the calibration gas standard used for calibration and frequency of calibration.

1. Specification

Item	Description
Ex Marking	ATEX : CE ₂₀₀₄ II 1 G Ex ia IIC T4 Ga IECEx : Ex ia II C T4 Ga
Approvals	IECEx : IECEx KTL 25.0023 ATEX : DEKRA 25ATEX0088
Dimensions	87x50x41 mm (Alligator clip included)
Weight	103 g (Alligator clip included)
Temperature	-20 °C ~ 50 °C
Humidity	5 ~ 95% RH

Item	Description
IP	IP 67
Sensor type	O ₂ or CO or H ₂ S - electrochemical cell
Alarms	Visual, vibrating, audible (min. 95dB)
Display	Liquid Crystal Display (LCD)
Battery	Primary lithium-thionyl chloride (Li-SOCl ₂)
Event Log	Last 128 events. Newer events replace older events.
Battery Life	24 Months of operation / 2 minutes of alarm per day
Warranty	Full 2 years

2. Each part for WatchGas MGD

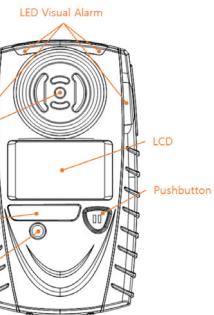

3

4. Activate a New Detector

- 1) Move to a normal atmosphere (20.9% v/v O₂) that is free of hazardous gas.
- 2) Press and hold the pushbutton until 5 second countdown is displayed, then continue to hold until the countdown is completed to activate WatchGas MGD.
- 3) When the countdown is completed, the LCD, LEDs, vibration, and beep turn on and then turn off.
- 4) The alarm setpoints are displayed and the sensor stabilization countdown is displayed. The time required to stabilize varies depending on sensor type. When the countdown reaches 0, the activation is completed.
* In case of WatchGas MGD O₂, when the countdown reaches 0, the zero calibration is performed automatically and after the zero calibration, the activation is completed.
- 5) The detector is in normal operating mode when the gas type and concentration are displayed.



- 3) The display information on the LCD is changed to the remaining product life from the current firmware version of the detector by pressing the button once. The unit of the remaining life will be changed automatically refer to the remaining life scale; '24M' - "1M", "30d" - "1d", "24h" - "1h"



- 4) The display information on the LCD is changed to the low alarm set value from the remaining product life by pressing the button once.



- 5) The display information on the LCD is changed to the high alarm set value from the low alarm set value by pressing the button once.
- 6) The display information on the LCD is changed to the normal display from the high alarm set value by pressing the button once if there is not any alarm event occurred within the past 10 hours.




- 2) The display information on the LCD is changed to the current firmware version of the detector from the normal display by pressing the button once. The number before the underline '_' means major number of the firmware version, and the number after the underline means minor number. In other word, "0_02" indicates the firmware number is '0.02'
- 7) Or if there is any alarm event occurred within the past 10 hours, the display information on the LCD is changed to elapsed time since the alarm occurred from the high alarm set value by pressing the button once, and then it is changed to the alarm value occurred by pressing the button once again, and it is changed to the normal display by pressing the button once again.

5. Normal Operating Mode



- 1) When the detector is in normal operating mode, the type of gas detected is permanently displayed. The detected concentration of the gas is displayed until it is disrupted by a pushbutton action, gas alarm, or error event. If you want to see the status information about the detector, please press the pushbutton once.

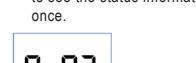

- 2) The display information on the LCD is changed to the current firmware version of the detector from the normal display by pressing the button once. The number before the underline '_' means major number of the firmware version, and the number after the underline means minor number. In other word, "0_02" indicates the firmware number is '0.02'

6

7

8

the button once again.

6. Alarms

An alarm is initiated when the sensor is exposed to a gas concentration that exceeds alarm setpoints. The alarm has two types; a low alarm and a high alarm. The alarm persists until the gas concentration returns to an acceptable range. Battery life decreases rapidly when the detector is in alarm condition. For WatchGas MGD O2 type, a low alarm occurs when the measured concentration value is lower than the low alarm setting value, while a high alarm occurs when the measured concentration value is higher than the high alarm setting value. The following alarm settings are default for each detector gas type.

Gas Type	Low Alarm	High Alarm
O ₂	19% v/v O ₂	23% v/v O ₂
CO	25 ppm	25 ppm
H ₂ S	10.0 ppm	15.0 ppm

When the alarm occurs, LEDs flash, vibration and beep sounds occur and display will be changed as below for example.



7. Bump test

- 1) Press the button twice at the normal operating mode in succession to get into the menu, it shows "BUMP" on the screen.
- 2) Press and hold the button until a 3 second countdown is displayed, then continue to hold until the countdown is completed to perform the bump test.
- 3) Then the gas injection display, the low alarm setpoint display, and the high alarm setpoint display occur cross and the detector waits for
- 4) Press and hold the button until a 3 second countdown is displayed. Continue to hold until the countdown is completed.
- 5) Then "I-on" is displayed on the screen and the communication mode is ready to operate normally. With "I-on" displayed on the screen, proceed with the necessary actions via the PC software.



- 5) To exit communication mode, with "I-on" displayed, press the button until a 3-second countdown is displayed, then keep holding it until the countdown is completed.
- 6) When the countdown is completed, "oFF" is briefly displayed on the screen, and then "IrDA" is displayed, returning to the communication mode menu.

11. Display Off

Display off mode is supported for user convenience. With this mode, all indications except for the detection gas name are lost.

*** The display off mode is irrelevant to saving battery.*

- 1) Press the button twice at the normal operating mode in succession to get into the menu, it shows "BUMP" on the screen.
- 2) Press the button 4 times to display "oFF" on the screen.



- 3) Press and hold the button until a 3 second countdown is displayed. Continue to hold until the countdown is completed.
- 4) Then the LED, vibration and buzzer will turn on and off, and all indications except the gas name will disappear.
- 5) To exit the display off mode, press and hold the button until the 3

injection of gas which causes an alarm.



- 4) If the detector detects the gas concentration for the bump test, the bump test process is performed automatically. The result will be displayed on the screen at the end of the test. If an alarm occurs during the bump test, the test is succeeded, otherwise the test is failed.

8. Zero The Sensor

Incuse of WatchGas MGD O2, over time and through use, the sensor baseline at zero exposure may drift from the manufacturer's baseline. For optimal performance of O2 models, it is recommended to zero the O2 sensor at least once in a month at the condition of room temperature and in a fresh air environment (20.9% v/v O₂) that is free of hazardous gas. The user will be noted by the display of the calibration reminder icon when the sensor calibration is due. If the icon is showing please zero the sensor as instructed below:

**** For all gas types, we recommend to zero the sensor periodically**

- 1) Move to a normal atmosphere (20.9% v/v O₂) that is free of hazardous gas.
- 2) Press the button twice at the normal operating mode in succession to get into the menu.
- 3) "BUMP" will be displayed on the screen.
- 4) "ZERO" is displayed on the screen by pressing the button once, then press and hold the button until a 3-second countdown is displayed. Continue to hold until the countdown is completed to calibrate zero.
- 5) Wait until the zeroing process is completed. When the zeroing process is completed, "PASS" or "FAIL" appears.
- 6) After displaying the result, "ZERO" is displayed on the screen again automatically.
- 7) If "FAIL" appears, repeat the zeroing process according to above procedure.
- 8) If the zeroing process fails again, please contact our service center.
- 9) To calibrate gas, press the button once, and "SPAN" will be displayed on the

screen. Continue calibrating according to the "Calibration Gas" section.

- 10) Or to exit the menu, press the button repeatedly to go back to normal operating mode.

9. Gas Calibration

This mode requires necessarily a gas at a calibration gas concentration. Only perform this mode if that gas is available. Performing this mode without that gas will cause the calibration to fail and generate a fail icon, which will not disappear until this mode is successfully completed. Furthermore, calibration with the wrong concentration may cause serious problems in gas concentration measurement.

For more optimal performance of WatchGas MGD, gas calibration may be needed. To calibrate the detector, we recommend gas calibration after doing zero calibration at room temperature and in a fresh air environment (20.9% v/v O₂) that is free of hazardous gas. By default, WatchGas MGD is configured to use the following calibration gas mixtures:

Gas Type	Standard Calibration Gas Concentration
O ₂	18% v/v O ₂
CO	100 ppm (balance N ₂)
H ₂ S	25 ppm (balance N ₂)


- 1) Move to a normal atmosphere (20.9% v/v O₂) that is free of hazardous gas.
- 2) Press the button twice at the normal operating mode in succession to get into the menu. "BUMP" will be displayed on the screen.
- 3) "ZERO" will be displayed on the screen by pressing the button once, by pressing the button again, "SPAN" will be displayed on the screen.
- 4) Press and hold the button until a 3-second countdown is displayed. Continue to hold until the countdown is completed.
- 5) The gas injection display and the standard calibration gas concentration display occur cross and the detector waits for injection of calibration gas.

10

11

0:2011, IEC 60079-11:2011 ATEX: EN 60079-0:2012 + A11 : 2013, EN 60079-11:2012 The product may be used in zones 0, 1 & 2 with flammable gases and vapors with apparatus groups IIC and with temperature classes T1, T2, T3, T4.

- 3) The product is only certified for use in ambient temperatures in the range -20°C ≤ Ta ≤ +50°C and should not be used outside this range. With regard to explosion safety, it is not necessary to check for correct operation.
- 4) The product contains no user-replaceable parts and is not intended to be repaired by the user.
- 5) Repair of the equipment is to be carried out by the manufacturer, or their approved agents, in accordance with the applicable code of practice.
- 6) The certificate label is described as below.

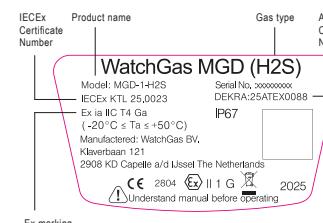

15. Ordering Information

WatchGas MGD 1-gas detector H2S

24 months disposable

partnumber: 7201001

WatchGas MGD 1-gas detector CO

24 months disposable

partnumber: 7201002

WatchGas MGD 1-gas detector O2

24 months disposable

partnumber: 7201003



- 6) If the detector detects the gas concentration for the gas calibration, the gas calibration process will be performed automatically.
- 7) When the gas calibration process is completed, "PASS" or "FAIL" appears.
- 8) After displaying the result, "SPAN" will be displayed on the screen again automatically.
- 9) If "FAIL" appeared, repeat the gas calibration process according to above procedure.
- 10) If the gas calibration fails again, please contact our service center.
- 11) Or to exit the menu, press the button repeatedly to go back to normal operating mode.

10. Infrared Communication

IrDA communication mode is supported for user convenience. A separate PC software is required in order to use this mode normally. In this mode, you can check WatchGas MGD internal.

** Battery life decreases more rapidly during use the infrared communication mode. It is recommended to save battery by using infrared communication mode only when absolutely necessary.*

- 1) Press the button twice at the normal operating mode in succession to get into the menu, it shows "BUMP" on the screen.
- 2) Press the button 3 times to display "I" on the screen.



12

WatchGas MGD IR-bridge
partnumber: 7201800

Model numbers:

- MGD-1: Model name
- X: Gas type (O2 : O2 Gas, CO: CO gas, H2S: H2S Gas)
- Y: Housing body colour (OG: Orange, YE: yellow, VT: violet, GN: green, etc.)

** This option is not marked on the label and can be used only at an order if the user wants a special housing body colour different from the default.*

REV.	CONTENTS	DATE
1.1	Initial Document	28 AUG 2025
1.2	Added chapter 10 and chapter 11 and scaled and rearranged for printing	27 OCT 2025

For more information
www.watchgas.com
info@watchgas.com

Europe

Klaverbaan 121
2908 KD Capelle aan den IJssel
The Netherlands

Americas

313 N. State Hwy 342
Red Oak, TX 75154
USA

APAC

Woods Square Tower1,
12 Woodlands Square,
#11-71, Singapore 737715

13

14

15

16